ECS Configuration Change Request					Page 1 of Page(s)			je(s)
1. Originator	2. Log Date:	3. CCR #:	4. R	ev:	5. Tel:	6.	Rm #:	7. Dept.
Henry Baez	05/20/03	03-0353	-	-	301-925-1025	21	01D	Sys Eng
8. CCR Title: Upgrade IBM OS with latest 10/100Mbit PCI drivers on VATC firewalls.								
9. Originator Signature/Date			10. Class	Class 11. Type: 12. Need Date: 05-21-2003			: 05-21-2003	
Henry Baez /s/ 05/20/03			IN					
13. Office Manager Signature/Date			14. Catego	-	CILL DIVIL 07)		"Emergency"	
Jim Mather /s/ 05/20	Initial ECS Baseline Doc. fill In Block 27). Emergency							
16. Documentation/Drawing checklist):	7. Schedule mpact:	18. CI(s) A	s) Affected:					
19. Release Affected by thi	o Customer: 21. Estimated Cost: None - Under 100K							
22. Source Reference: ☐NCR (attach) ☐Action Item ☐Tech Ref. ☐GSFC ☑Other: SMC Trouble Ticket #5725								
23. Problem: (use additional Sheets if necessary)  Firewall at GDAAC has been reporting random interrupt error (INTRPPC_ERR) for 10/100Mbit NIC used for M&O LAN connectivity. IBM is aware of this error and has made patch available (devices.pci.23100020.rte.4.3.3.80). GDAAC has requested assistance from Landover security engineers to test IBM patch followed by formal delivery. This error has been seen several times at SMC and once on LPDAAC firewall.								
24. Proposed Solution: (use additional sheets if necessary) Install and test IBM fielset/driver devices.pci.23100020.rte.4.3.3.80 in the VATC firewall. Will make sure new fileset does not impact normal operations. No formal test is needed.								
25. Alternate Solution: (use additional sheets if necessary) Leave IBM fileset/drive at persent version devices.pci.23100020.rte.4.3.3.78.								
26. Consequences if Change(s) are not approved: (use additional sheets if necessary) IBM has stated that the problem "should" not crash the system. But GDAAC is seeing this error message every day. It is filling up IBM error logs very fast. This error was also reported at SMC and LPDAAC.								
27. Justification for Emergency (If Block 15 is "Emergency"):								
28. Site(s) Affected: DF DVC VATC DDC GSFC LaRC NSIDC SMC AK JPL DCC DDG Test Cell Other								
29. Board Comments:			3	0. W	ork Assigned T	o: 31	. CCR C	losed Date:
32. EDF/SCDV CCB Chair ( Byron V. Peters /s/ 0	Sign/Date): Dis 05/21/03	position: Ar Fv	oproved Applyd/ECS	o/Con	n. Disapproved	Withd	Iraw Fw	d/ESDIS ERB
33. M&O CCB Chair (Sign/I	Date): Dis	position: Ap		/Com	n. Disapproved	Withd	Iraw Fwd	/ESDIS ERB
04 F00 C07 C1 : 'C1 :=			vd/ECS	<u> </u>	D	1400		WEODIA
34. ECS CCB Chair (Sign/D	ate): Disp	osition: App	proved App	Com.	. Disapproved	vvithd	ıraw Fw	d/ESDIS ERB

CM01JA00 Revised 8/2/02 ECS/EDF/SCDV/M&O

Fwd/ESDIS